# Full specification

#### Design standards

- Existing BREEAM Very Good building
- Developed in 1999 and extended in 2009 Wired Score - Platinum
- · Cycling Score Platinum
- ActiveScore Platinum
- Smart Buildings Enabled

#### **Occupancy standards**

- 30 WCs in line with BS 6465-1 BCO for a 'whole building provision'
- Fire Risk Assessment (FRA) Maximum occupancy of 700 (existing FRA) for lettable
- areas is 1 person per 6.5 m<sup>2</sup> Fresh air and comfort cooling maximum
- occupation density 1 person per 8 m<sup>2</sup>

## Structure and building fabric

Grade II Listed building with façade retention to 19th century historic elevations. Largely concrete framed with concrete waffle floor slabs, extended with steel frame and insitu concrete floors

#### Car parking

11 spaces in total, of which 2 is accessible. 4No. 7.2KW electrical charging points for electric vehicles

## Cycle & changing facilities

60 spaces for cycle parking in doubled stacked racks and 8 spaces in lockers for folding cycles in a secure and covered cycle store. An additional 8 are in Sheffield stands within the enclosed car park. E-Bike charging facilities also provided.

Cycle repair facility and defined cycle route.

4 male and 4 female showers are provided within changing facility on the ground floor, plus 1 which is unisex fully wheelchair accessible.

66 lockers with 4 drying lockers. Communal hair dryers and ironing facilities provided.

#### Floorplates

- Floor to ceiling height 2600 mm with
- 4200mm to areas of the ground floor 110mm to 150mm raised access floor void (to maiority)
- Loading of office areas 4 + 1 kN/m2 with enhanced loading of 7.5 kN/m2 to plant room.

## Environmental services

The building uses a variable refrigerant flow (VRF) heat pump system to meet the space heating and cooling demands of the building. The entire system is newly installed in 2021 and is of Mitsubishi or Daikin manufacture.

Both the internal and external components of the system are suitable for heat recovery applications to enable individual units or groups of units to heat and cool simultaneously, utilising the waste heat from one group to contribute positively to the heat demand of another group.

There is space on the roof and in the offices for Tenant installed air-conditioning and condensers for supplementary cooling to meeting rooms etc. and branch controllers are specified with 25% spare capacity to install additional fan coil units as necessary.

System configuration has been designed to allow sub-division of each floorplate along a notional floor separation whilst providing separate VRF systems to each area. Fan coil units follow the BCO standard configuration for maximum flexibility for tenant fit-out.

Each tenancy has control of heating and cooling set points from a control panel within each demise

## Ventilation

The building is provided with a centralised air handling unit (AHU) to deliver supply and extract ventilation throughout the office accommodation. The unit has been upgraded in 2021 to provide high efficiency fan units, enhanced filtration and UV sterilisation to maximise bacterial security of the system. Fresh air is tempered at the AHU, and all air delivered through fan coil units to ensure no cold draughts occur.

# Heating and cooling performance

24°C +/- 2°C Office Office areas (summer) areas (winter) 20 +/- 2°C min Fresh air 10 ls/m<sup>2</sup> Occupancy density 1 person per 8 m<sup>2</sup>

## Electrical services

Office areas lighting 400 Lux Dali Addressable flat panel LED ceiling recessed light fittings by a proprietary manufacturer.

Fire Alarm L2 analogue addressable fire alarm system complying with BS5839

Power Offices - 25W/sqM Telecoms and data Structured cable system to CAT6 cable provided to serve the Landlord's infrastructure and systems eg. the main Landlord telephony system, Access Control, CCTV, BMS, remote alarm signalling. Infrastructure is provided in the main service risers for tenant fit-out, i.e. distribution route for incoming voice and data services.

100MB internet fibre lease line provision to each tenant demise at day one, with IGB upgrade possible within 2 weeks. Provision via third party supply contract with Technology Within.

Landlords Wifi system to main reception area on a fair usage basis.

## Access control

- Reception desk at ground floor manned during office hours (8:00 – 17:00).
- Facility for Key card/fob access/smart phone controllable to the main and rear entrances, as well the lifts.
- Cable ways for tenant's Key card/fob access from landings to individual floor suites provided, with integration to the Landlords access control system easily achieved.

#### ссту

CCTV comprehensively covering the car park, cycle store, building access points, reception and ground floor common areas.

#### BMS

A Building management system is provided, which provides autonomous control of all 'Landlord's' services including fault monitoring and sub-metering

The electricity consumption for each demise is sub-metered using MID certified meters, reporting to a centralised data collection system.

# WC and shower facilities

- Typical floor
- 5 unisex superloo rooms within the core. 1 additional wheelchair accessible unisex WC.
- Ground floor
- 3 unisex superloo rooms within the core.
- 1 WC in each male and female shower hub
- 1 additional wheelchair accessible unisex WC (with shower).
- 1WC off reception
- Cleaner's store.
- 4 male and 4 female shower cubicles with changing.
- Unisex wheelchair accessible shower
- and changing room within the core.

#### Common areas and circulation space Reception

- · Large reception area containing bespoke reception desk, manned 08:00 – 17:00 on weekdays, informal meeting / working area and soft seating.
- Ancillary facilities for reception staff.
- Circulation lifts and stairs

Two 8 person lifts, one of which is a firefighting lift. Three staircases; a main staircase and two

secondary staircases, situated at either end of the building.

# Sustainability features

- Photovoltaic installation on the roof Electric Vehicle charging
- Low water use appliances
- Automatic lighting controls with presence detection
- DALI addressable lighting
- Excellent cyclist facilities
- State of the art air filtration
- UV treatment for air supply
- Central mechanical ventilation with heat recoverv
- New VRF heat pump system throughout
- BREEAM Offices rating Very Good (2009)

#### Reception Floor

- · 1200X600 Terrazzo tiles with inset bespoke
- satin brass feature inlays.
- Radial entrance barrier matting Walls
- Fluted effect glazing within crittal effect metal
- frames internally Backlit barrisol luminaire panelled screen with
- black hot rolled steel finish skirting
- Black metal panels with feature timber laminate panelling
- Full height glazing to soft seating areas
- overlooking planters

## Ceilina

Part exposed concrete waffle slab with coordinated exposed services, part suspended plasterboard with inset SAS metal feature ceilina inserts.

# Fitted furniture

- Bespoke reception desk Lighting
- Feature down and strip lighting in additional

#### to LED lightwall Loose furniture

Brass handrails

escape stairs).

floor level.

fire resistance.

Polyrey laminate.

drying facilities.

benches

Floor

Walls

female changing rooms.

in 2019.

Stairs

2.4m high cars and doors.

Inset aluminium nosings.

- · Soft seating, coffee table, table and chairs to informal working area
- New automated sliding circular entrance door
- with glazed side screens and feature portal

Lifts open directly onto the floorplate and

8 person, 650 kg. Lift gear fully overhauled

Painted steel stair with screed infill to steps

Painted steel balustrades and aluminium

Custom vinyl signage and graphics at each

Vision panels to office landings with 60min

Toilet facilities are unisex via superloos and

are separated by full- height partitions with

enhanced acoustic performance. Doors are

Shower cubicles provide individual changing,

showering and drying within separate male/

There are also large male/female changing

rooms together with lockers and dedicated

Feature Timber Laminate panelling to shower

and changing areas with integrated counter

Toughened glass shower screens and doors

Laminate panelling to changing and WCs.

Maxwood Marante WC cubicle system with

Polyrey laminate IPS' and integral doorsets

High quality wall hung WCs with concealed

Wall hung basins, mirrors and feature lights

Polished medium duty raised access floor.

Re-coated windows to Victoria Street and

Counterslip with new feature glazing to part

New SAS330 metal suspended ceiling with

Inset low glare LED flat panel lighting with

Plasterboard perimeter with inset lighting.

Potable water connections to floor plates

feature inserts and fleece backing.

Painted plasterboard with feature decorations.

Paper towel dispensers, WC roll holders, coat

and wash hand basins with mirrors Maxwood Oracle Z-lockers with integrated

Good quality ceramic tiles / LVT.

Tiled within shower cubicles

cisterns and push plate flush

Hand dryers to accessible WCs.

Sanitaryware and fittings

hooks, oiled steel shelfs

Painted timber cills

New window handles

Dali Addressable system

Office floors

of 4th floor

Floors

Walls

Ceiling

handrails (painted to escape stairs).

Surface mounted light fittings.

WCs and shower/changing rooms

and landings, finished with LVT (sheet vinyl to


feature linked access control system.

metal panel with mirrors to rear walls.

· Landlords Wifi system on a fair usage basis

Timber laminate panelling to side walls, Zintec

#### Lifts 2 lifts (one of which is fire evacuation lift)

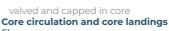

Floor

Walls

Ceiling

Ceramic floor tiles / LVT

Painted plasterboard.

Internal Doors

External Doors

Main entrance

Refuse store

Car park

Risers

Car park

coating

cvcle store

surface mounted lights.

external sign, tenant's

Floor

Walls

Ceiling

Cycle store

steel frame

Floor

Walls

Ceiling

Features

ironmongery

Overhead door heater

 Painted plasterboard with inset crittal effect glazed doorsets onto floor plates.

Generally: 2082mm high to offices from landings.2660mm to superloos. Laminated timber doors, solid-core with timber frames. Riser doors to be paint finish.

- Doors from landings onto floor plates to be crittal effect glazed, fire rated.
- Good quality Stainless steel ironmongery. Glazed double doors as part of partition system to ground floor lettable units.

Automatic sliding circular entrance door with glazed side screens inset within feature portal.

Ground floor lettable units

Aluminium framed glazed doors to suit

historic façade as required

Fire escape doors to stair shafts Powder coated aluminium doors

External doors to rear elevation

· Crittall effect metal doorsets (power assisted to main entrance from car park/cycle store)

New timber bifold gates to secure enclosure Rooftop plant access doors Painted timber doors with louvres as required

Powder coated powered roller shutter with access control and ventilation perforations.

Painted timber with Stainless steel

Specialist (partly coloured) Rhinophalt tarmac

Thermoplastic line markings Ramped access to powered rear door

Exposed brickwork to outer walls with iroko timber panels to the rear elevation and

Powder coated metal soffit lining system with

Specialist coloured Rhinophalt tarmac coating.

Iroko forest cladding panels supported on

Dark grey soffit cladding Double stacked cycle stands for 60 cycles and enclosed storage for 8 folding cycles

Access control, CCTV, steel door with safety viewing, cycle repair station

# Signage, graphics and wayfinding

Bespoke signage and graphics package to include an allowance for main building

board, floor level markers, WC and shower identification separate from statutory

## signage allowance.

Lighting Generally to front of house, core, WC and shower facilities and landscape areas: luminaires by high quality manufacturers, with LED lamps.

## **Building envelope**

· Stone repairs to dressed stonework with light cleaning

- Cleaning of cills and brickwork
- Repair and redecoration of painted timber Re-coating of powder coated aluminium windows to Victoria Street and
- Counterslip elevations Roof repairs, cleaning down and extension
- to mansafe system Re-coating of rainwater goods
- New feature glazing to reception and part ground floor offices
- Enhanced roof terrace to fourth floor with planters